

Figure - Bug #111312

测试 Test-IT # 110867 (New): V1.0测试功能汇总

测试 Test-IT # 110872 (New): BSP-BVT测试-WIFI测试

【AF】【EVT】【settings】【必现】打开/关闭网络设置，settings页面发生闪退或anr

2022-08-17 19:27 - SZTS_TEST 邹涛

Status:	CLOSED	Start date:	2022-08-17
Priority:	High	Due date:	2022-08-19
Assignee:	SZTS_TEST 邹涛	% Done:	100%
Category:	CD-FW	Estimated time:	0.00 hour
Target version:	VX1_MCE_FSE_V2.0_20220930	Found Version:	0.0.0.20220826_alpha_private_userdebug
Need_Info:	--	Degrated:	--
Resolution:	FIXED	Verified Version:	
Severity:	Critical	Fixed Version:	
Reproducibility:	Every time	Root cause:	bug产生的原因是settings的裁剪时,通过修改config配
Test Type:	Bring Up Test		

Description
前置条件： 1、 DUT各模块功能正常且处于开机状态
操作步骤： 1、 settings首页，打开/关闭网络设置，返回settings首页时；查看页面显示
实际结果： 1、 setting页面直接闪退或者报anr
预期结果 1、 返回setting页面正常显示无任何异常，不会发生闪退和anr

History

#1 - 2022-08-19 11:24 - CD TPM-申艳艳
- Assignee changed from SZ TPM-罗云进 to CD FW-程天颖
#2 - 2022-08-26 11:15 - CD FW-程天颖
- Due date set to 2022-08-19
- Status changed from New to RESOLVED
- Assignee changed from CD FW-程天颖 to SZ TPM-罗云进
- Target version set to 600
- % Done changed from 0 to 100
- Resolution changed from -- to FIXED
■ Current conclusion
该bug已解决,自测通过,代码已入库
■ My analysis
bug产生的原因是settings的裁剪时,通过修改config配置文件裁剪飞行模式,在AirplaneModePreferenceController.java中读取配置文件,初始化时,没有实例化对象,造成了空指针异常
解决方法:把AirplaneModePreferenceController从父级页面中移除,不允许被裁减的页面的代码
■ Next action / ■ Submit URL

- #3 - 2022-08-29 18:21 - SZTS_TEST 邹涛
- Status changed from RESOLVED to VERIFIED
 - Assignee changed from SZ TPM-罗云进 to SZTS_TEST 邹涛
 - Found Version changed from 0.0.0.20220817_alpha_private_userdebug to 0.0.0.20220826_alpha_private_userdebug

0.0.0.20220826_alpha_private_userdebug，版本验证问题已修复；关闭该bug

- #4 - 2022-08-29 18:25 - SZTS_TEST 邹涛
- Status changed from VERIFIED to CLOSED

- #5 - 2022-09-14 11:50 - CD TPM-申艳艳
- Category set to CD-FW

- #6 - 2022-09-16 09:48 - CD SWPM-杨宏伟
- Target version changed from 600 to VX1_MCE_FSE_V2.0_20220930

- #7 - 2022-09-16 16:03 - CD FW-程天颖
- Root cause set to bug产生的原因是settings的裁剪时,通过修改config配置文件裁剪飞行模式,在AirplaneModePreferenceController.java中读取配置文件,初始化时,没有实例化对象,造成了空指针异常

- #8 - 2022-12-22 20:25 - CD FW-王伟

Gerrit Merge Information :

ID	Project	Branch	Uploader
143643	general/platform/packages/apps/Settins	Pre_figure_turbox-c2130c-la1.1-qssi12-dev	tianying.cheng@thundersoft.com
AF:Settings crop: Fix crash of AirplaneModePreferenceController1.fixed air plan mode creshTC-RID: 1201-0201801IssueID: TS-R-DF-111312Change-Id: I9d9b0e09956c21aca5db9f9fb5234f2b59ec28fd			

- #9 - 2022-12-22 20:25 - CD FW-王伟

Gerrit Merge Information :

ID	Project	Branch	Uploader
143736	general/platform/packages/apps/Settins	Pre_figure_turbox-c2130c-la1.1-qssi12-dev	tianying.cheng@thundersoft.com
AF:Settings display:option mode1.change hotseat_dir to option mode.TC-RID: 1201-0201801IssueID: TS-R-DF-111312Change-Id: Ifee466e51484e65766c3ae693975c23c491c0b64			

- #10 - 2023-04-06 18:35 - CD BSP-杜磊

- Subject changed from 【BSP】【EVT】【settings】【必现】打开/关闭网络设置，settings页面发生闪退或anr to 【AF】【EVT】【settings】【必现】打开/关

闭网络设置，settings页面发生闪退或anr

Files				
logcat_setting页面闪退.txt	2.79 MB	2022-08-17	SZTS_TEST 邹涛	
Serial-COM4_20220817161659.log	1.56 MB	2022-08-17	SZTS_TEST 邹涛	