

Figure - Bug #112003

【Figure】【EVT】【电气性能】E09 反向电压：试验中，WiFi，蓝牙，视频和以太网功能失效，试验后，重新上电操作，WiFi，蓝牙，视频和以太网功能正常。

2022-09-16 15:18 - SZ HW Test-曾小文

Status:	CLOSED	Start date:	2022-09-16
Priority:	High	Due date:	
Assignee:	项目二组_SD3 曾小文	% Done:	90%
Category:	依赖软件规避的bug	Estimated time:	0.00 hour
Target version:	依赖硬件的bugList	Found Version:	2022.08.25
Need_Info:	--	Degraded:	--
Resolution:	DUPLICATE	Verified Version:	
Severity:	Major	Fixed Version:	
Reproducibility:	Every time	Root cause:	
Test Type:	Release Test		
Description			
需要能自动恢复			
Related issues:			
Related to Figure - Bug # 112005: 【Figure】【EVT】【电气性能】E18 ...		CLOSED	2022-09-16 2022-10-28

History

#1 - 2022-09-16 15:40 - CD BSP-唐金泽

- File Q / HH-TS002-2022_电子电气零部件环境可靠性规范.pdf added
- Status changed from New to ASSIGNED
- Assignee changed from CD BSP-唐金泽 to CD BSP-陈杰

#2 - 2022-09-23 16:35 - IOT-SP-TEST 刘颖

- Assignee changed from CD BSP-陈杰 to 项目部_SD3 吴超

我们对测试结果有异议，请实验室安排重新测试；请吴超和小文对一下

#3 - 2022-09-26 11:12 - SZ HW Test-曾小文

- Assignee changed from 项目部_SD3 吴超 to CD BSP-杜磊

软件增加记忆功能

#4 - 2022-09-27 11:20 - 物联网项目组-RD3_CDTs 周飞

- Target version set to 依赖硬件的bugList

#5 - 2022-10-17 14:35 - CD BSP-杜磊

- Assignee changed from CD BSP-杜磊 to CD BSP-陈杰

#6 - 2022-10-17 14:43 - CD BSP-陈杰

- Assignee changed from CD BSP-陈杰 to SZ-硬件二组_SD3 王苗
- % Done changed from 0 to 90

目前已经完成功能，自测通过，需要预约到实验室进行测试，出报告。

#7 - 2022-10-24 11:07 - SZ-硬件二组_SD3 王苗
- Assignee changed from SZ-硬件二组_SD3 王苗 to CD BSP-陈杰

已经去实验室复测，与实验室测试工程师对齐。目前存在问题1.以太网连接下，重启机器需要wifi自动连接；2.CAN需要自动连接而且数据自动收发；

#8 - 2022-10-26 19:36 - CD BSP-陈杰
- Assignee changed from CD BSP-陈杰 to SZ-硬件二组_SD3 王苗

目前已经完成wifi和以太网共存功能，并已经测试成功。can功能目前测试能自动连接，并实现收发。需注意，使用canfd工具的时候，当设备断电时，不能点击自动发送，待设备上电，才能进行自动发送，原因是can盒子发送一次超时时，就需要断开连接在进行连接。

#9 - 2022-10-27 19:34 - IOT-SP-TEST 刘颖

TO 王成，
1、请用最新版本验证，当WiFi和以太网共存时，WiFi是否可以自动连接；需要的功能是WiFi可以自动连接。
2、如果验证OK，请将此问题转给曾小文，最终在实验室确认。

#10 - 2022-10-27 19:37 - IOT-SP-TEST 刘颖
- Assignee changed from SZ-硬件二组_SD3 王苗 to CDTS_TEST 王成

#11 - 2022-10-28 09:57 - CDTS-TEST 周婷
- Category changed from BSP to 依赖软件规避的bug

#12 - 2022-10-28 10:10 - CDTS_TEST 王成
- Assignee changed from CDTS_TEST 王成 to CDTS_TEST 刘勇

验证如上问题，通过后指派给曾小文

#13 - 2022-10-28 18:20 - CDTS_TEST 刘勇

【HW】EVT2-VX1-整机
【SW】FlatBuild_HH_VX1_MCE_FSE.M.D.userdebug.01.00.X101.202210280405
【前提】
烧录版本
【操作步骤】
1.链接以太网、WIFI（加密和非加密SSID）
2.ADB reboot 查看重启后wifi是否自动链接
【实际结果】
2.设备重启后 WIFI自动回连
【验证次数】
3次

#14 - 2022-10-28 18:20 - CDTS_TEST 刘勇
- Assignee changed from CDTS_TEST 刘勇 to 项目二组_SD3 曾小文

#15 - 2022-11-02 16:34 - IOT-SP-TEST 刘颖
- Status changed from ASSIGNED to RESOLVED

与 Bug112005为同一个问题，待问题112005解决后，验证后关闭

#16 - 2022-11-16 20:10 - CD BSP-唐金泽
- Status changed from RESOLVED to VERIFIED
- Resolution changed from -- to DUPLICATE

请单独提交CAN自动链接的CASE
现在CAN 自动链接，依赖硬测使用CANoe进行验证

#17 - 2022-11-17 16:10 - SZ HW Test-曾小文

待EVT2样机在实验室复测OK后再关闭BUG

#18 - 2022-11-28 10:30 - SZ HW Test-曾小文
- Status changed from VERIFIED to CLOSED

EVT2复测PASS

Files			
Q / HH-TS002-2022_电子电气零部件环境可靠性规范.pdf	4.23 MB	2022-09-16	CD BSP-唐金泽