

Figure - Bug #112131

测试 Test-IT # 110961 (New): V2.0功能测试

测试 Test-IT # 111056 (New): AF-V2.0-Launcher/SystemUI----Setting

【AF】【EVT】【设置】系统-日期与时间-时区-点击区域settings崩溃

2022-09-26 11:41 - CD TEST-方永红

Status:	CLOSED	Start date:	2022-09-26
Priority:	Urgent	Due date:	2022-09-29
Assignee:	CD TEST-方永红	% Done:	100%
Category:	CD-FW	Estimated time:	0.00 hour
Target version:	VX1_MCE_FSE_V2.0_20220930		
Need_Info:	--	Found Version:	FlatBuild_VX1_MCE_xx.xx_FSE.D.userdebug.0.0.0.20220929
Resolution:	FIXED	Degrated:	No
Severity:	Critical	Verified Version:	FlatBuild_VX1_MCE_xx.xx_FSE.R.user.0.0.0.20220929
Reproducibility:	Every time	Fixed Version:	2022-09-28
Test Type:	IT	Root cause:	编码问题
Description			
【前提条件】 设备已开机 【测试步骤】 1、进入设置 系统-日期与时间-时区 2、点击区域 【预期结果】 2、进入区域选择模式 【实际结果】 2、点击之后settings崩溃 【复现率】 必现			

History

- #1 - 2022-09-26 13:37 - CD FW-程天颖
- Assignee changed from CD FW-程天颖 to CD AF-陈羽杰
- #2 - 2022-09-26 16:40 - CD TEST-方永红
- Found Version changed from FlatBuild_VX1_MCE_xx.xx_FSE.R.user.0.0.0.20220924.alpha_0019 to FlatBuild_VX1_MCE_xx.xx_FSE.D.userdebug.0.0.0.20220924.alpha
- #3 - 2022-09-27 10:27 - CD TEST-方永红
- Priority changed from Normal to Urgent
- Severity changed from Normal to Major
- #4 - 2022-09-27 19:59 - CDTS_TEST 王成
- Severity changed from Major to Critical
- #5 - 2022-09-28 11:17 - CD AF-陈羽杰
- Status changed from New to ASSIGNED
- #6 - 2022-09-28 11:20 - CD AF-陈羽杰

- % Done changed from 0 to 60
- Degrated changed from -- to No

■ Current conclusion

已定位到问题

■ My analysis

由于修改双屏显示，父布局NestedScrollView嵌套RecyclerView，导致RecyclerView服用模式失效，从而创建大量viewholder使系统发生Anr导致崩溃。

■ Next action

本地修改，取消NestedScrollView验证。

#7 - 2022-09-28 15:43 - CD AF-陈羽杰

- Status changed from ASSIGNED to RESOLVED
- Assignee changed from CD AF-陈羽杰 to CD TEST-方永红
- % Done changed from 60 to 100
- Resolution changed from -- to FIXED
- Fixed Version set to 2022-09-28
- Root cause set to 编码问题

■ Current conclusion

已修复

■ My analysis

由于修改双屏显示，父布局NestedScrollView嵌套RecyclerView，导致RecyclerView服用模式失效，从而创建大量viewholder使系统发生Anr导致崩溃。

■ submit url

<https://dev.thundercomm.com/gerriit/c/general/platform/packages/apps/Settings/+152503>

#8 - 2022-09-29 18:01 - CD TEST-方永红

- Status changed from RESOLVED to VERIFIED
- Verified Version set to FlatBuild_VX1_MCE_xx.xx_FSE.R.user.0.0.0.20220929.alpha_0025

#9 - 2022-09-29 18:01 - CD TEST-方永红

- Status changed from VERIFIED to CLOSED

#10 - 2022-12-22 20:38 - CD FW-王伟

Gerrit Merge Information :

ID	Project	Branch	Uploader
152503	general/platform/packages/apps/Settins	Pre_figure_turbox-c2130c-la1.1-qssi12-dev	yujie.chen@thundersoft.com
AF:Settings: Fix Settings loading slow Bug1.Fix TimeZone Loading Slow2.Fix Developer Mode Loading SlowTC-RID: 1201-0201809IssueID: TS-R-BUG-112131,TS-R-BUG-112115Change-Id: I4fda9460879629c5c45e94ee860dbd22979946a8			

Files

系统-时区-区域崩溃.log	6.97 KB	2022-09-26	CD TEST-方永红
----------------	---------	------------	-------------