

Figure - Bug #112606

测试 Test-IT # 110961 (New): V2.0功能测试

测试 Test-IT # 111056 (New): AF-V2.0-Launcher/SystemUI----Setting

【AF】【EVT】【设置】通过长按设置添加一个电池的快捷方式，打开该快捷方式，再点击左上角的返回按钮，页面有概率跳转至网络与互联网

2022-10-17 16:46 - CD TEST-方永红

Status:	CLOSED	Start date:	2022-10-17
Priority:	Normal	Due date:	2022-10-19
Assignee:	CD TEST-方永红	% Done:	100%
Category:	CD-FW	Estimated time:	0.00 hour
Target version:	VX1_MCE_FSE_V3.0_20221030	Found Version:	FlatBuild_VX1_MCE_xx.xx_FSE.R.userdebug.0.0.0.20221023
Need_Info:	--	Degrated:	No
Resolution:	FIXED	Verified Version:	FlatBuild_VX1_MCE_xx.xx_FSE.D.user.0.0.0.20221023
Severity:	Normal	Fixed Version:	
Reproducibility:	Occasionally	Root cause:	编码问题
Test Type:	IT		
Description			
【前提条件】			
1、设备已开机			
【测试步骤】			
1、长按设置图标，在弹出的选择框中拖动电池，将其快捷方式添加至桌面			
2、打开该快捷方式			
3、点击左上角的返回按钮			
【预期结果】			
3、直接返回桌面			
【实际结果】			
3、页面有概率跳转至网络与互联网且快捷方式的标题取代该页面标题（如图）			
【复现率】			
10%			
ps:			
1、经实验，通过添加微件添加的电池快捷方式也会出现该现象			
2、该现象在设置相关的快捷方式中均有出现			

History

#1 - 2022-10-19 14:41 - CD AF-陈羽杰

- Status changed from New to ASSIGNED

#2 - 2022-10-19 14:42 - CD AF-陈羽杰

- Due date set to 2022-10-19

- Status changed from ASSIGNED to RESOLVED

- Assignee changed from CD AF-陈羽杰 to CD TEST-方永红

- % Done changed from 0 to 100

- Resolution changed from -- to FIXED

- Degrated changed from -- to No

- Root cause set to 编码问题

■ Current conclusion
已修复本地验证

■ My analysis
对外部跳转settings 判断不够准确，导致添加重复页面，从而导致白屏

■Submit URL
<https://dev.thundercomm.com/gerrit/c/general/platform/packages/apps/Settings/+156316>

#3 - 2022-10-20 11:30 - CD TEST-方永红

- File 12.txt added

- File 电池2.png added

- Status changed from RESOLVED to VERIFY_FAILED

- Assignee changed from CD TEST-方永红 to CD AF-陈羽杰

10.20

重复10次之后再次出现该问题

#4 - 2022-10-20 18:12 - CD AF-陈羽杰

- Status changed from VERIFY_FAILED to ASSIGNED

#5 - 2022-10-21 09:39 - CD AF-陈羽杰

- Status changed from ASSIGNED to RESOLVED

- Assignee changed from CD AF-陈羽杰 to CD TEST-方永红

■ Current conclusion
已修复本地验证

■ My analysis
settings未启动时快捷方式跳转到Settings会先启动wifi页面，导致返回时出现页面异常

■Submit URL
<https://dev.thundercomm.com/gerrit/c/general/platform/packages/apps/Settings/+156750>

#6 - 2022-10-24 10:32 - CD TEST-方永红

- Status changed from RESOLVED to VERIFIED

- Verified Version set to FlatBuild_VX1_MCE_xx.xx_FSE.D.user.0.0.0.20221023.alpha

10.24 验证30次未复现，先关闭

#7 - 2022-10-24 10:33 - CD TEST-方永红

- Status changed from VERIFIED to CLOSED

#8 - 2022-12-22 20:45 - CD FW-王伟

Gerrit Merge Information :

ID	Project	Branch	Uploader
156750	general/platform/packages/apps/Settin gs	Pre_figure_turbox-c2130c-la1.1-qssi12 -dev	yujie.chen@thundersoft.com

AF:Settings: Fix outside jump to Settings Exception1.Press and hold the setting to add a battery shortcut, open the shortcut, click the return button at the upper left corner, and the page has a probability to jump to the network and InternetTC-RID: 1201-0201813IssueID: TS-R-BUG-112606Change-Id: I64919ee7407fb56f38aa9054b941eaafcad8fcd2

Files			
电池.png	90.3 KB	2022-10-17	CD TEST-方永红
3.txt	2.5 MB	2022-10-17	CD TEST-方永红
12.txt	6.69 MB	2022-10-20	CD TEST-方永红
电池2.png	94.8 KB	2022-10-20	CD TEST-方永红