

Figure - Bug #112812

测试 Test-IT # 110961 (New): V2.0功能测试
测试 Test-IT # 111056 (New): AF-V2.0-Launcher/SystemUI---Setting

【AF】【EVT】【设置】进入WIFI列表页面->进入一个WiFi连接页面->等待设备进入屏保->唤醒设备后，页面显示不合理

2022-10-24 16:01 - CD TEST-方永红

Status:	CLOSED	Start date:	2022-10-24
Priority:	Normal	Due date:	2022-10-25
Assignee:	CD TEST-方永红	% Done:	100%
Category:	CD-FW	Estimated time:	0.00 hour
Target version:	VX1_MCE_FSE_V3.0_20221030	Found Version:	FlatBuild_VX1_MCE_xx.xx_FSE.D.user.0.0.0.20221023
Need_Info:	--	Degrated:	--
Resolution:	FIXED	Verified Version:	FlatBuild_VX1_MCE_xx.xx_FSE.D.user.0.0.0.20221023
Severity:	Normal	Fixed Version:	
Reproducibility:	Every time	Root cause:	编码问题
Test Type:	IT		
Description			
【前提条件】 1、设备已开机 2、未连接WiFi 【测试步骤】 1、进入设置 - 网络和互联网 - 打开Wlan 2、进入一个WiFi连接页面 3、等待设备进入屏保 4、单击屏幕，退出屏保模式 【预期结果】 4、正常显示WiFi连接页面（如图1） 【实际结果】 4、页面中多出一个WLAN开关按钮（如图2） 【复现率】 5/10 【日志】 日志见附件			

History

#1 - 2022-10-24 16:06 - CD TEST-方永红

复现步骤补充：
在wifi连接页面返回桌面，再进入设置，也会出现该现象

#2 - 2022-10-25 10:48 - CD AF-陈羽杰
- Status changed from New to ASSIGNED

#3 - 2022-10-25 18:57 - CD AF-陈羽杰

- Due date set to 2022-10-25
- Status changed from ASSIGNED to RESOLVED
- Assignee changed from CD AF-陈羽杰 to CD TEST-方永红
- % Done changed from 0 to 100
- Resolution changed from -- to FIXED
- Verified Version set to 编码问题

■ Current conclusion

本地已验证修复

■ My analysis

由于原先的switchBar是每个页面单独拥有的，改为双屏显示后，所有页面公用一个switchBar，导致控制出现问题。

■ Submit URL

<https://dev.thundercomm.com/gerrit/c/general/platform/packages/apps/Settings/+/157777>

#4 - 2022-10-26 10:23 - CD AF-陈羽杰

- Verified Version deleted (编码问题)
- Root cause set to 编码问题

#5 - 2022-10-26 10:32 - CD TEST-方永红

- Status changed from RESOLVED to VERIFIED
- Verified Version set to FlatBuild_VX1_MCE_xx.xx_FSE.D.user.0.0.0.20221026.alpha

10.26 验证关闭

#6 - 2022-10-26 10:32 - CD TEST-方永红

- Status changed from VERIFIED to CLOSED

#7 - 2022-12-22 20:46 - CD FW-王伟

Gerrit Merge Information :

ID	Project	Branch	Uploader
157777	general/platform/packages/apps/Settings	Pre_figure_turbox-c2130c-la1.1-qssi12-dev	yujie.chen@thundersoft.com
AF:Settings: Fix mainSwitchBar don't fight for the right time1.remove HomeSettingsActivity control switchBar2.add wifiFragment Development buleToothFragment control switchBarTC-RID: 1201-0201813IssueID: TS-R-BUG-112812Change-Id: Iea36af954ed2b65a618cb693050c19326701a418			

Files

1559.txt	6 MB	2022-10-24	CD TEST-方永红
1549.png	167 KB	2022-10-24	CD TEST-方永红
正常.png	180 KB	2022-10-24	CD TEST-方永红