

Figure - Bug #115861

测试 Test-ST # 114575 (New): V5.0功能测试票

测试 Test-ST # 114577 (New): Launcher/SystemUI

【AF】【EVT】【桌面】刷机后或恢复出厂设置后底部导航尺寸不对，重启一次才能恢复正常

2023-02-03 16:13 - CD TEST-方永红

Status:	CLOSED	Start date:	2023-02-03
Priority:	High	Due date:	2023-02-07
Assignee:	CD TEST-方永红	% Done:	100%
Category:	CD-APP	Estimated time:	0.00 hour
Target version:			
Need_Info:	--	Found Version:	FlatBuild_HH_VX1_MCE_FSE.M.D.user.01.00.X101.2
Resolution:	FIXED	Degrated:	--
Severity:	Normal	Verified Version:	FlatBuild_HH_VX1_MCE_FSE.M.R.user.01.00.0073.X
Reproducibility:	Every time	Fixed Version:	2023-02-09
Test Type:	ST	Root cause:	问题原因：overlay的值定义存在问题 问题
Description			
【前提条件】			
1、刷机后或恢复出厂设置后			
【测试步骤】			
1、打开一个应用			
2、查看底部导航条尺寸			
【预期结果】			
1、导航条高度符合规定			
【实际结果】			
1、导航条高度明显小于规定高度			
重启之后可恢复正常			

History

- #1 - 2023-02-06 10:58 - CD APP-王营
- Due date set to 2023-02-07
 - Status changed from New to ASSIGNED
 - Assignee changed from CD APP-王营 to CD FW王武军

#2 - 2023-02-06 19:39 - CD FW王武军

- 【】当前状态
- 确认问题现象，开始调查分析。
- 【】问题调查
- 刷机或者恢复出厂设置，获取的高度是24；
- 重启之后，或者的高度是72。从两者的差别来看，可能存在res资源加载的异常。
- 【】后续动作
- 沿着导航栏导读res资源包的方向进行调查

#3 - 2023-02-08 15:23 - IoT scm

Gerrit Merge Information :

ID	Project	Branch	Uploader

179690	general/platform/vendor/thundercom m/overlay	Pre_figure_turbox-c2130c-la1.1-qssi12 -dev	wujun.wang@thundersoft.com
AF:NavigationBar: define navigationBar heightSet the navigation mode is 2, so need definethe fit value in the gesture overlay and frameoverlay.TC-RID: 1201-0201904IssueID: TS-R-BUG-115861Change-Id: Icba670a9eae380eb81576d169acd66b1d56761cd			

#4 - 2023-02-08 15:23 - IoT scm

Gerrit Merge Information :

ID	Project	Branch	Uploader
179698	general/platform/frameworks/base	Pre_figure_turbox-c2130c-la1.1-qssi12 -dev	wujun.wang@thundersoft.com
AF:NavigationBar: define navigationBar heightSet the navigation mode is 2, so need definethe fit value in the gesture overlay and frameoverlay.TC-RID: 1201-0201904IssueID: TS-R-BUG-115861Change-Id: I0024dafa57e372b1dad28bac548f68c806c03453			

#5 - 2023-02-08 15:27 - CD FW王武军

- Status changed from ASSIGNED to RESOLVED
- Assignee changed from CD FW王武军 to CD TEST- 方永红
- Resolution changed from -- to FIXED
- Fixed Version set to 2023-02-09
- Root cause set to 问题原因 : overlay的值定义存在问题
- 问题修改 : 调整overlay的值定义 , 确保加载正确的高度值

#6 - 2023-02-08 15:28 - CD FW王武军

- % Done changed from 0 to 100

#7 - 2023-02-09 11:18 - CD TEST-方永红

- Status changed from RESOLVED to VERIFIED
- Verified Version set to FlatBuild_HH_VX1_MCE_FSE.M.R.user.01.00.0073.X101

2.9

刷机 and 恢复出厂设置后底部导航条尺寸正常 , 重启也不会发生变化
验证通过

#8 - 2023-02-09 11:18 - CD TEST-方永红

- Status changed from VERIFIED to CLOSED