

Status:	CLOSED	Start date:	2023-04-19
Priority:	High	Due date:	
Assignee:	物联网测试组_TSCD 王维	% Done:	100%
Category:	BSP	Estimated time:	0.00 hour
Target version:			
Need_Info:	--	Found Version:	01.00.0094.C103版本
Resolution:	FIXED	Degrated:	--
Severity:	Normal	Verified Version:	
Reproducibility:	Every time	Fixed Version:	
Test Type:	ST	Root cause:	#117329已解决
Description			
使用0x1C2002作为一个块刷写，3601必现无响应 使用0xFEB02作为一个块刷写，几率性在某一个块刷写失败			
【备注】 安卓原生系统与以太网诊断服务偶发同时对以太网控制模式寄存器0x8034进行异步刷写，导致出现异常，从而引起传输功能异常； 对控制模式寄存器0x8034修改值为正常值后，电路板基本能回复正常。将优化以太网诊断方案。 01.00.0094.C103版本回归（4/25）			

History

- #1 - 2023-04-20 11:43 - CD BSP 叶鹏
- Assignee changed from CD BSP 叶鹏 to CD_BSP 彭文亮
- #2 - 2023-04-21 09:44 - CD_BSP 彭文亮
- 此BUG与 <https://share.thundersoft.com/redmine/issues/117329#change-542815> 重复，均是来源于客户jira 583。该如何关闭此BUG?
- #3 - 2023-05-04 10:22 - CD BSP-杜磊
- Status changed from ASSIGNED to RESOLVED
- Assignee changed from CD_BSP 彭文亮 to 物联网测试组_TSCD 王维
- % Done changed from 0 to 100
- #4 - 2023-05-06 18:31 - CD BSP-杜磊
- Resolution changed from -- to FIXED
- Root cause set to #117329已解决
- #5 - 2023-05-09 10:51 - CDTS_Test 吴诗雨
- Status changed from RESOLVED to VERIFIED
- #6 - 2023-05-09 10:52 - CDTS_Test 吴诗雨
- Status changed from VERIFIED to CLOSED

Files

image-2023-04-18-09-23-37-694 (1).png	214 KB	2023-04-19	物联网测试组_TSCD 王维
---------------------------------------	--------	------------	----------------