

Status:	CLOSED	Start date:	2023-05-29
Priority:	Normal	Due date:	
Assignee:	CD TEST-方永红	% Done:	100%
Category:	CD-APP	Estimated time:	0.00 hour
Target version:			
Need_Info:	--	Found Version:	01.00.0100.c103
Resolution:	FIXED	Degrated:	No
Severity:	Normal	Verified Version:	
Reproducibility:	Every time	Fixed Version:	2023-06-07
Test Type:	ST	Root cause:	AOSP问题
Description			
【环境信息】EE环境 【问题出现时间】：20230529 15：25 【前提条件】：副屏上电；中控、功放已连接；副屏、中控时间一致 【操作步骤】 1.中控发送洗车模式命令，副屏熄屏 2.停止命令，副屏亮屏 【实际结果】 1.副屏显示docs栏抖动 【期望结果】 1.副屏正常显示 【备注】： 第167次开机 开机时长： 日志、视频地址：https://ofs.human-horizons.com/#!/download/index/WPPZe%2FPAVk4%3D 中控VIN号：HRYTTESTVINMGM817 【中控版本号】：03.02.0086.c102 【副屏版本号】：01.00.0100.c103			

History

#1 - 2023-05-29 20:17 - CDTs_TEST 王成

- File 飞车20230529-154812.mp4 added

#2 - 2023-05-29 20:19 - CD FW 曹覃刚

- Category changed from CD-FW to CD-APP

- Status changed from New to ASSIGNED

- Assignee changed from CD FW 曹覃刚 to CD APP-王营

Hi 王营

dock栏在缓慢的上下抖动，请帮忙分析

#3 - 2023-05-30 10:35 - CD APP-王营

- Assignee changed from CD APP-王营 to CD APP-王宏

【分析】

1、此动画为Dock正常现象，初次进入Launcher时，Dock会有上下跳动的引导动画

【下一步】

1、确认副屏是否有数据重置的操作。

2、洗车模式结束会向副屏发送什么样的通知。

#4 - 2023-05-30 11:32 - CD APP-王宏

- Assignee changed from CD APP-王宏 to CD APP-王营

Hi 王营,

根据在hotset中打印堆栈

```
@Override
public void setTranslationY(float translationY) {
    super.setTranslationY(translationY);
    Log.d(TAG, "setTranslationY: " + translationY, new Exception());
}
```

跟踪到DiscoveryBounce#showForHomelfNeeded(),这是控制hotseat抖动的方法，

可打印其中的控制条件，对比正常和意外情况下有何不同，从而有针对的跟踪定位到该问题

#5 - 2023-05-30 15:58 - CD APP-王营

- Status changed from ASSIGNED to NEED_INFO

- Assignee changed from CD APP-王营 to CDTS_TEST 王成

【分析】

非bug，此现象是Dock的上下跳动动画，此动画在手势在初次使用Launcher时候或者息屏亮屏后被激活，洗车模式就是将副屏息屏，结束后唤醒屏幕，此时系统触发此动画。

【下一步】

原生功能，测试确认，关闭此问题。

#6 - 2023-06-01 21:28 - CD TEST-方永红

- Status changed from NEED_INFO to RESOLVED

- % Done changed from 0 to 100

- Resolution changed from -- to WONTFIX

#7 - 2023-06-01 21:28 - CD TEST-方永红

- Status changed from RESOLVED to VERIFIED

#8 - 2023-06-01 21:28 - CD TEST-方永红

- Status changed from VERIFIED to CLOSED

#9 - 2023-06-05 20:21 - CD TEST-方永红

- Status changed from CLOSED to New
- Assignee changed from CDTS_TEST 王成 to CD APP-王莹

客户恢复：
试过副屏自己熄屏和亮屏，还有中控控制熄屏在亮屏都不会出现dock抖动现象、麻烦分析一下

- #10 - 2023-06-06 14:20 - CD APP-王莹
- Status changed from New to RESOLVED
 - Assignee changed from CD APP-王莹 to CD TEST-方永红
 - Resolution changed from WONTFIX to FIXED
 - Degrated changed from -- to No
 - Fixed Version set to 2023-06-07
 - Root cause set to AOSP问题

【状态】
1、Dock上下跳动动画已删除

【提交】
<https://dev.thundercomm.com/gerrit/c/general/platform/packages/apps/Launcher3/+205051>

#11 - 2023-06-06 14:25 - IoT scm

Gerrit Merge Information：

ID	Project	Branch	Uploader
205051	general/platform/packages/apps/Launcher3	Pre_figure_turbox-c2130c-la1.1-qssi12-dev	ying.wang@thundersoft.com
AF: Launcher: Remove Dock jump animationTC-RID: 1201-0205301IssueID: TS-R-BUG-118352Change-Id: Id2a94b59c3608d0fae0aa22e9685fd548da2e167			

- #12 - 2023-06-09 13:46 - SZTS_TEST 邹涛
- Status changed from RESOLVED to VERIFIED

在 FlatBuild_HH_MCE_FSE.M.D.user.01.00.C104.202306090153版本验证通过

- #13 - 2023-06-25 14:24 - CD TEST-方永红
- Status changed from VERIFIED to CLOSED

Files			
15.25 100版本 第166次开机 副屏在中控发送洗车模式命令结束后，docs栏出现抖动现象.7z	2023-05-29		CDTS_TEST 王成
飞书20230529-154812.mp4	11.6 MB	2023-05-29	CDTS_TEST 王成