

Figure - Bug #118426

【BSP】【EVT3】【ST】【OTA】使用OTA升级到0601的最新 0106后，断电-上电会偶现需要2分钟才能开机，且开机后eth与中控连接失败

2023-06-01 15:42 - 移动测试一组_CDTs 刘强

Status:	CLOSED	Start date:	2023-06-01
Priority:	High	Due date:	
Assignee:	CD TPM-王祥林	% Done:	100%
Category:	CD-FW	Estimated time:	0.00 hour
Target version:		Found Version:	最新 0601 : 0106
Need_Info:	--	Degrated:	--
Resolution:	--	Verified Version:	
Severity:	Major	Fixed Version:	
Reproducibility:	Frequently	Root cause:	
Test Type:	ST		
Description			
前置条件：			
DUT各模块功能正常且处于开机状态			
操作步骤：			
1、烧写0102 或其他user版本			
2、使用OTA升级到最新版本：0106			
实际结果：			
1、开机后会偶现需要2分钟才能进入系统，且进入系统后eth和中控连接失败			
预期结果：			
1、开机后以太网正常连接，开机时间满足要求			

History

- #1 - 2023-06-01 15:44 - CD TPM-王祥林
- 开机慢的问题是由于改118360这个monkey的bug，有概率会导致开机的时候系统服务发生死锁，导致system_server被kill后android上层重启一次，所以会在开机动画的时间比较长。修改patch已入库
- <https://dev.thundercomm.com/gerrit/c/general/platform/frameworks/base/+204047>
- #2 - 2023-06-02 20:23 - 移动测试一组_CDTs 刘强
- Status changed from New to ASSIGNED
- % Done changed from 0 to 100
- 验证通过，关闭问题单 验证版本6/2 0106版本
- #3 - 2023-06-02 20:23 - 移动测试一组_CDTs 刘强
- Status changed from ASSIGNED to RESOLVED
- #4 - 2023-06-02 20:23 - 移动测试一组_CDTs 刘强
- Status changed from RESOLVED to VERIFIED

#5 - 2023-06-02 20:23 - 移动测试一组_CDTS 刘强
- Status changed from VERIFIED to CLOSED

Files			
106.txt	1.85 MB	2023-06-01	移动测试一组_CDTS 刘强