

Status:	CLOSED	Start date:	2023-06-01
Priority:	Normal	Due date:	
Assignee:	CDTS_Test 吴诗雨	% Done:	100%
Category:	CD-FW	Estimated time:	0.00 hour
Target version:			
Need_Info:	--	Found Version:	【中控版本号】：03.02.0086.C102
Resolution:	FIXED	Degrated:	No
Severity:	Normal	Verified Version:	
Reproducibility:	Every time	Fixed Version:	2023-06-02
Test Type:	ST	Root cause:	外部跳转 Settings 适配问题。
Description			
环境信息】EE环境			
【问题出现时间】：20230601 20：34			
【前提条件】：副屏上电，中控已连接			
【操作步骤】			
1.打开系统设置上滑手势返回主界面			
2.主界面下滑手势进入控制中心			
3.点击互联网按钮			
4.选择一个连接的热点			
【实际结果】			
1.底层多任务栏同时存在两个设置页面			
【期望结果】			
1.底层多任务栏只能存在一个设置页面，操作3、4步骤时自动跳转到设置对应选项			
【备注】：			
【当前开机次数】：146			
【应用版本】：			
【硬件版本号】：			
VIN:HRYTTESTVINMGM401			
【中控版本号】：03.02.0086.C102			
【副屏版本号】：01.00.0100.c103			

History

#1 - 2023-06-01 21:27 - CDTs_Test 吴诗雨

ftp://cdiot@192.168.87.46/Pre_figure/Test_Log/Bug_118445

#2 - 2023-06-02 11:30 - CD FW-廖涛
- Status changed from New to ASSIGNED

- Assignee changed from CD FW-廖涛 to CD APP-王宏

Hi, 王宏:
帮忙看下 Recent 中出现两个 Settings 的原因。如果是启动方式的问题再转回给我，我来处理。

#3 - 2023-06-02 14:08 - CD APP-王宏
- Assignee changed from CD APP-王宏 to CD FW-廖涛

Hi 廖涛，
根据日志是开启了两个界面

2023-06-02 08:12:25.518 4790-17956/system_process I/ActivityTaskManager: START u0 {act=android.settings.WIFI_DETAILS_SETTINGS flg=0x14000000 cmp=com.android.settings/.Settings\$WifiDetailsSettingsActivity (has extras)} from uid 10083
2023-06-02 08:12:25.795 4790-4897/system_process I/ActivityTaskManager: START u0 {act=android.settings.WIFI_DETAILS_SETTINGS flg=0x14000000 cmp=com.android.settings/.homepage.SettingsHomepageActivity (has extras)} from uid 1000

是否是这两个界面都有独立的进程导致的？

#4 - 2023-06-02 17:36 - CD FW-廖涛
- % Done changed from 0 to 100
- Degrated changed from -- to No
- Root cause set to 外部跳转Settings 适配问题。

■ Current conclusion
已处理，代码已提交。

■ Next action
等待 Review 入库。

#5 - 2023-06-02 19:14 - IoT scm

Gerrit Merge Information :

ID	Project	Branch	Uploader
204332	general/platform/packages/apps/Settins	Pre_figure_turbox-c2130c-la1.1-qssi12-dev	tao.liao@thundersoft.com
AF:Settings: Fix navigate to Wifi Detail Page problem.TC-RID: 1201-0201801IssueID: TS-R-BUG-118445Change-Id: I390512abf399c0472d37854f94897a1d43ae4930			

#6 - 2023-06-02 19:22 - CD FW-廖涛
- Status changed from ASSIGNED to RESOLVED
- Assignee changed from CD FW-廖涛 to CDTS_Test 吴诗雨
- Resolution changed from -- to FIXED
- Fixed Version set to 2023-06-02

■ Current conclusion

已处理，代码已入库。

■ Next action

测试验证。

#7 - 2023-06-03 17:52 - CDTS_Test 吴诗雨

已同步，设备跑测，周一验证

#8 - 2023-06-06 13:57 - SZTS_TEST 邹涛

- Status changed from RESOLVED to VERIFIED

在01.00.0108.C104版本验证通过

#9 - 2023-06-12 16:39 - CDTS_Test 吴诗雨

- Status changed from VERIFIED to VERIFY_FAILED

0610版本，从控制中心的位置信息长按进入设置，出现两个设置。

#10 - 2023-06-12 16:39 - CDTS_Test 吴诗雨

- Status changed from VERIFY_FAILED to ASSIGNED

- Assignee changed from CDTS_Test 吴诗雨 to CD FW-廖涛

#11 - 2023-06-12 16:40 - CDTS_Test 吴诗雨

- Status changed from ASSIGNED to RESOLVED

- Assignee changed from CD FW-廖涛 to CDTS_Test 吴诗雨

从控制中心的位置信息长按进入设置，出现两个设置。另起bug跟踪，118745

#12 - 2023-06-12 16:41 - CDTS_Test 吴诗雨

- Status changed from RESOLVED to VERIFIED

#13 - 2023-06-12 16:46 - CDTS_Test 吴诗雨

- Status changed from VERIFIED to CLOSED

Files

IOVDEV-32233.zip	4.89 MB	2023-06-01	CDTS_Test 吴诗雨
------------------	---------	------------	---------------