

Figure - Bug #118799

测试 Test-ST # 113421 (New): V4.0功能与专项测试

测试 Test-ST # 113423 (New): V4.0专项--BSP专项--稳定性-各项功能长时间运行

Bug # 118789 (CLOSED): 【BSP】 【EVT】 【稳定性】用adb命令进行长时间按压测试，状态栏出现异常，重启进入900E

dump

2023-06-15 15:53 - CD TEST-方永红

Status:	CLOSED	Start date:	2023-06-15
Priority:	Normal	Due date:	
Assignee:	CD TEST-方永红	% Done:	0%
Category:	BSP	Estimated time:	0.00 hour
Target version:		Found Version:	110(613版)
Need_Info:	--	Degrated:	--
Resolution:	FIXED	Verified Version:	
Severity:	Normal	Fixed Version:	
Reproducibility:	Rarely	Root cause:	
Test Type:	ST		
Description			
1.616395] kernel BUG at kernel/time/timer.c:988! [1.616403] Internal error: Oops - BUG: 0 [#1] PREEMPT SMP [1.616408] Modules linked in: [1.616415] Process swapper/0 (pid: 1, stack limit = 0x000000002866e02f) [1.616420] CPU: 3 PID: 1 Comm: swapper/0 Tainted: G S W 4.19.157-perf+ #1 [1.616425] Hardware name: Qualcomm Technologies, Inc. kona MTP-RmPM8150b. VX1(MCE) EVT2 (DT) [1.616430] pstate: 60800085 (nZCv daIf -PAN +UAO) [1.616440] pc : mod_timer+0x584/0x588 [1.616445] lr : add_timer+0x18/0x28 [1.616449] sp : fffff800805b7c0 [1.616453] x29: fffff800805b7d0 x28: fffff9c62d296b8 [1.616459] x27: fffff9c62dfa000 x26: fffff9c629040b0 [1.616464] x25: 0000000000000004 x24: fffff9c62913018 [1.616470] x23: 0000000000000066 x22: 0000000000000000 [1.616475] x21: 0000000000000001 x20: fffffe4d5a76000 [1.616481] x19: 0000000000000000 x18: fffffe4f7565b00 [1.616487] x17: fffffe4f7581800 x16: 0000000000000060 [1.616492] x15: 0000000000000004 x14: 0000000000000001 [1.616497] x13: 0000000000000007 x12: 0000000000000013 [1.616502] x11: 0000000000000000 x10: fffff9c62c06000 [1.616508] x9 : 00000000fffee17d x8 : 0000000000000000 [1.616513] x7 : 0000000000000000 x6 : fffff800805b4c5 [1.616518] x5 : 0000000000000001 x4 : 0000000000000004 [1.616523] x3 : 00000000000004e2 x2 : fffffe4d5b00ca8 [1.616528] x1 : 00000000fffee17d x0 : fffffe4d5b00cd8 [1.616533] Call trace: [1.616539] mod_timer+0x584/0x588 [1.616544] add_timer+0x18/0x28 [1.616549] queue_delayed_work_on+0x98/0xf8 [1.616554] pwm_fan_set_cur_state+0x168/0x170 [1.616559] thermal_cdev_update+0x158/0x218 [1.616564] step_wise_throttle+0x54/0x80 [1.616569] handle_thermal_trip+0x210/0x308 [1.616574] thermal_zone_device_update+0x150/0x198			

```

[ 1.616579] __thermal_cooling_device_register+0x434/0x448
[ 1.616584] thermal_of_cooling_device_register+0xc/0x18
[ 1.616589] pwm_fan_probe+0x3ec/0x4d8
[ 1.616595] platform_drv_probe+0x7c/0xb8
[ 1.616599] really_probe+0x43c/0x4c8
[ 1.616604] driver_probe_device+0x60/0xf8
[ 1.616609] __driver_attach+0xe8/0x128
[ 1.616615] bus_for_each_dev+0x78/0xc0
[ 1.616620] driver_attach+0x20/0x28
[ 1.616625] bus_add_driver+0x120/0x200
[ 1.616630] driver_register+0x74/0x108
[ 1.616635] __platform_driver_register+0x40/0x48
[ 1.616640] pwm_fan_driver_init+0x18/0x20
[ 1.616644] do_one_initcall+0x11c/0x280
[ 1.616649] kernel_init_freeable+0x2dc/0x390
[ 1.616655] kernel_init+0x14/0x290
[ 1.616660] ret_from_fork+0x10/0x18
[ 1.616667] Code: d4210000 17ffff51 d4210000 17fffffc (d4210000)
[ 1.616675] ---[ end trace 07ea3774be7925cf ]---
[ 1.618456] Kernel panic - not syncing: Attempted to kill init! exitcode=0x0000000b
[ 1.618456]
[ 1.618469] SMP: stopping secondary CPUs
[ 2.218618] cnss: Crash shutdown with driver_state 0x0
[ 2.218628] cnss: Device is already powered off, skip
[ 2.218645] ipa ipa3_active_clients_panic_notifier:305
[ 2.218645] ---- Active Clients Table ----
[ 2.218645]
[ 2.218645] Total active clients count: 0
[ 2.218645]
[ 2.218659] Kernel Offset: 0x1c58a00000 from 0xfffff80080000000

```

History

#1 - 2023-06-16 19:54 - IoT scm

Gerrit Merge Information :

ID	Project	Branch	Uploader
207856	general/kernel/msm-4.19	Pre_figure_turbox-c2130c-la1.1-vendor-dev	yepeng0322@thundersoft.com
BSP: PWM:Reordering the work queuePWM:Reordering the work queueTC-RID: 1201-0102803IssueID: TS-R-DF-118799Change-Id: Ibd2568c2b1d5c47bf5b0467196e34f0004979457			

#2 - 2023-06-18 22:03 - IoT scm

Gerrit Merge Information :

ID	Project	Branch	Uploader
208052	general/kernel/msm-4.19	Pre_figure_turbox-c2130c-la1.1-vendor-release_sorp	wangxl0510@thundersoft.com

BSP: PWM:Reordering the work queuePWM:Reordering the work queueTC-RID: 1201-0102803IssueID: TS-R-DF-118799Change-Id: lbd2568c2b1d5c47bf5b0467196e34f0004979457(cherry picked from commit d0173e67d9c7215888109efbce8cd5384ac96af0)

- #3 - 2023-06-20 15:48 - CD BSP 叶鹏
- Status changed from New to RESOLVED
- #4 - 2023-07-12 15:44 - CD TEST-方永红
- Status changed from RESOLVED to VERIFIED
- #5 - 2023-07-12 15:44 - CD TEST-方永红
- Status changed from VERIFIED to CLOSED
- Assignee changed from CD BSP 叶鹏 to CD TEST-方永红
- Resolution changed from -- to FIXED

Files

dmesg_TZ.txt	156 KB	2023-06-15	CD TEST-方永红
--------------	--------	------------	-------------